



USPO-12MK2-

name	date	city, state

NOTES

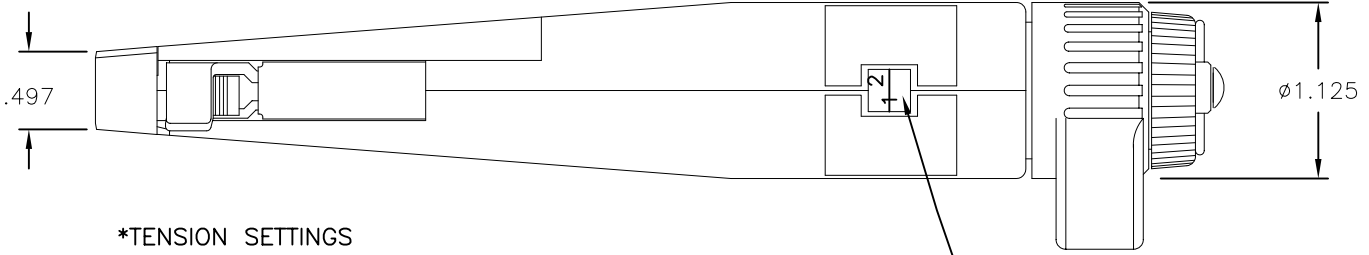

**\*TENSION SETTINGS**




TENSION INDICATOR WINDOW SETTINGS 1 - 8

TO INCREASE TENSION: Rotate knobs clockwise

MINIATURE = T18 TIES (.08"/.10" WIDE)

INTERMEDIATE = T30,T40 TIES (.14"/.15" WIDE)

STANDARD = T50 TIES (.18" WIDE)

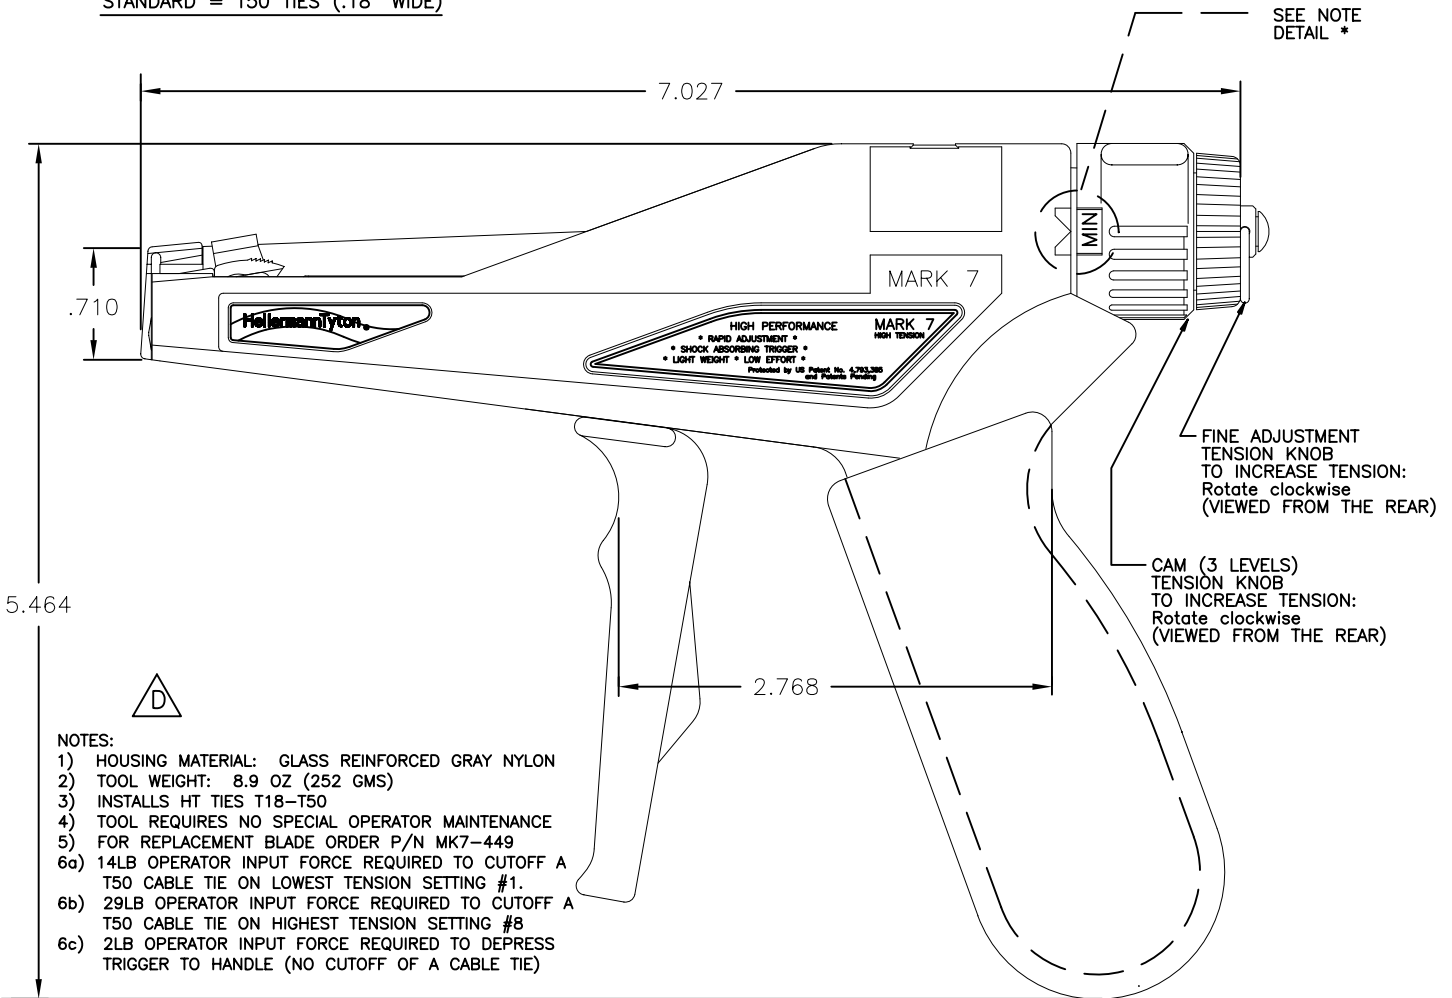

**NOTES:**

- 1) HOUSING MATERIAL: GLASS REINFORCED GRAY NYLON
- 2) TOOL WEIGHT: 8.9 OZ (252 GMS)
- 3) INSTALLS HT TIES T18-T50
- 4) TOOL REQUIRES NO SPECIAL OPERATOR MAINTENANCE
- 5) FOR REPLACEMENT BLADE ORDER P/N MK7-449
- 6a) 14LB OPERATOR INPUT FORCE REQUIRED TO CUTOFF A T50 CABLE TIE ON LOWEST TENSION SETTING #1.
- 6b) 29LB OPERATOR INPUT FORCE REQUIRED TO CUTOFF A T50 CABLE TIE ON HIGHEST TENSION SETTING #8
- 6c) 2LB OPERATOR INPUT FORCE REQUIRED TO DEPRESS TRIGGER TO HANDLE (NO CUTOFF OF A CABLE TIE)

REVISION	DR level	△ D	
	AW date		05/28/03
	IN by		AAC
	NG ECN #		003878
	part level		B

DIMENSIONS	TOLERANCES	.XXXX = ±.0005
		.XXX = ±.005
		.XX = ±.01
		.X = ±.03
		∠ = ±0.5°
		unless otherwise specified
		units inches

PART	number	MK7 HT	phase	PRODUCTION
	name	MARK 7 HT CABLE TIE TENSION TOOL		
	material	SEE INDIVIDUAL PART DRAWINGS		

DRAWING	FORMAT	AV	version	II	CAD	ACAD	scale	1.25X	
	computer file number	TS\CST\8406515_D						previous number	
	drawn	W.L.	checked	W.L.	approved				
	date	02/14/95	date	06/05/03	sheet	1 of 1			
	type	CUSTOMER						sheet	1 of 1
number	TS8406515CST								